



Area of application



ESC international, Installation/Service international



Document details



Document ID	ESC_HSE-Warning_2016-01_Click locks at safety harnesses_de-en.docx		
Confidentiality	FOR INTERNAL USE		
Date	Language	DCC	Plant/department
2016-02-19	en	QB	Service Deutschland GmbH/Health & Safety



Revision details



Revision	Change
000	- Document created

Topic

Click locks at safety harnesses

Areas concerned

Users of safety harnesses

Description

- It has been identified that an extremely small quantity of COBRA®-click locks, which are attached to safety harnesses, could have female parts with rivets, which have not been pressed properly
- These affected rivets could result in becoming loose

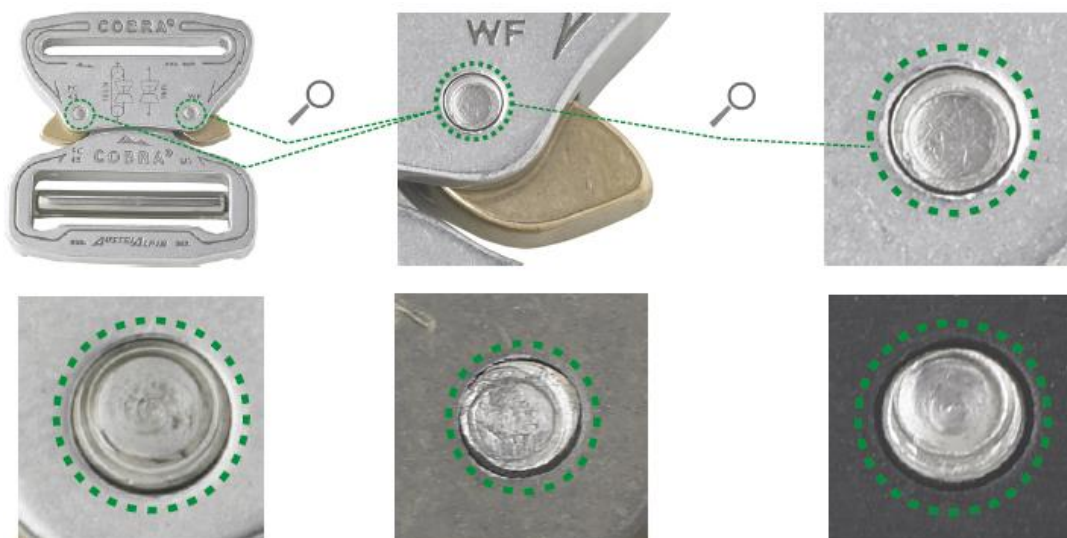


Fig. 1: Correct: The rivet shows an imprint in the shape of a ring on the front- and back side

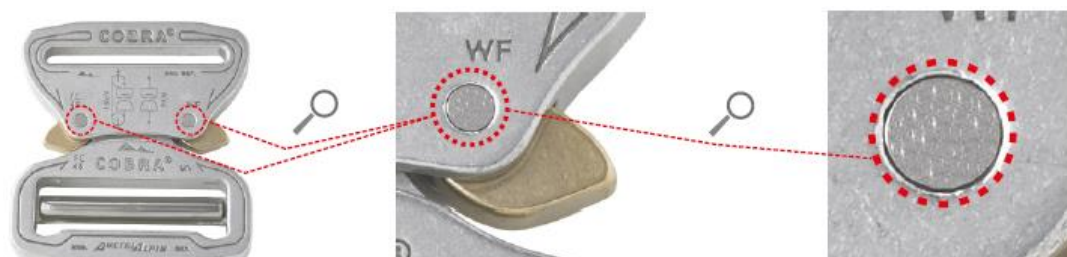


Fig. 2: Wrong: The rivet shows no imprint in the shape of a ring

Immediate action

1. Carry out a visual inspection of all click-locks on safety harnesses.
2. Click locks that are not pressed may no longer be used and have to be blocked from further use.
3. Affected safety harnesses have to be sent back to the central warehouse with a note stating this exact reason.

Address any questions or issues regarding this document to the Technical Service office or local H&S staff. If necessary, they can contact the ESC Health & Safety department.

If one of the above measures results in new insights or is not appropriate and changes or additional measures become necessary, immediately notify the Technical Service office or local H&S staff.